UNCLASSIFIED

AD NUMBER

AD025026

CLASSIFICATION CHANGES

TO: unclassified

FROM: confidential

LIMITATION CHANGES

TO:

Approved for public release, distribution unlimited

FROM:

Distribution authorized to U.S. Gov't. agencies and their contractors; Administrative/Operational Use; AUG 1953. Other requests shall be referred to Naval Proving Ground, Dahlgren, VA.

AUTHORITY

USNSWC Notice, 1 Mar 1978; USNSWC Notice, 1 Mar 1978

Armed Services Technical Information Agency

AD

PLEASE RETURN THIS COPY TO:

ARMED SERVICES TECHNICAL INFORMATION AGENCY
DOCUMENT SERVICE CENTER
Knott Building, Dayton 2, Ohio

Because of our limited supply you are requested to return this copy as soon as it has served your purposes so that it may be made available to others for reference use. Your cooperation will be appreciated.


NOTICE: WHEN GOVERNMENT OR OTHER DRAWINGS, SPECIFICATIONS OR OTHER DATA ARE USED FOR ANY PURPOSE OTHER THAN IN CONNECTION WITH A DEFINITELY RELATED GOVERNMENT PROCUREMENT OPERATION, THE U. S. GOVERNMENT THEREBY INCURS NO RESPONSIBILITY, NOR ANY OBLIGATION WHATSOEVER; AND THE FACT THAT THE GOVERNMENT MAY HAVE FORMULATED, FURNISHED, OR IN ANY WAY SUPPLIED THE SAID DRAWINGS, SPECIFICATIONS, OR OTHER DATA IS NOT TO BE REGARDED BY IMPLICATION OR OTHERWISE AS IN ANY MANNER LICENSING THE HOLDER OR ANY OTHER PERSON OR CORPORATION, OR CONVEYING ANY RIGHTS OR PERMISSION TO MANUFACTURE, USE OR SELL ANY PATENTED INVENTION THAT MAY IN ANY WAY BE RELATED THERETO.

Reproduced by
DOCUMENT SERVICE CENTER |
KNOTT BUILDING, DAYTON, 2, 0HIO

CONFIDENTIAL

NOTICE: THIS DOCUMENT CONTAINS INFORMATION AFFECTING THE NATIONAL DEFENSE OF THE UNITED STATES WITHIN THE MEANING OF THE ESPIONAGE LAWS, TITLE 18, U.S.C., SECTIONS 793 and 794.

THE TRANSMISSION OR THE REVELATION OF ITS CONTENTS IN ANY MANNER TO AN UNAUTHORIZED PERSON IS PROHIBITED BY LAW.

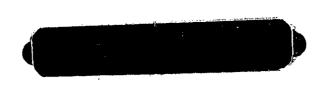

CONFIDENTIAL

SECURITY INFORMATION

U S. NAVAL PROVING GROUND DAHLGREN, VIRGINIA

REPORT NO. 1156

ARMY R&D AIRCRAFT ROCKET FUZES

5th Partial Report

DEVELOPMENT TEST OF P.D. ROCKET FUZE T-2025E2

FINAL Report

Assignment Chief of Ord. TA1-2704

Copy No. 5

Classification <u>CONFIDENTIAL</u> SECURITY INFORMATION

CONFIDENTIA

PART A

SYNOPSIS

- l. The first design of the T-2025 fuze, which incorporated an electric detonator, proved to be unsatisfactory from the standpoint of impact sensitivity and delay time after impact. The fuze was then redesigned, with a stab-type detonator in lieu of the electric detonator. This was designated as the T2025El fuze. The plate firing tests of the T-2025El fuze conducted at the Naval Proving Ground indicated erratic functioning on 24ST aluminum alloy targets ranging in thickness from "032 to "500. Since the Navy Mk 176 fuze for the 2"75 FFAR Rocket essentially meets all the requirements of the T-2025El fuze, it was decided to terminate the development of the T-2025El fuze and apply all effort toward the development of the T-2025E2 fuze which contains a self destruction feature. The Magnavox Co. of Fort Wayne, Indiana, are the designers and manufacturers of this fuze.
- 2. The present series of tests was conducted on the T-2025E2 fuze to determine:
 - a. Sensitivity
 - b. Delay in detonation on target impact
 - c. Functioning ability when subjected to oblique impacts
- 3. It is concluded that the T-2025E2 fuze:
- a. Will function on 24ST aluminum alloy targets as light as \$032 in thickness.
- b. Functioned on \$500 aluminum alloy targets with a delay time of approximately 300 microseconds.
- c. Will function on a light aluminum target ("032) at 60° obliquity.

NPG REPORT NO. 1156

Development Test of P.D. Rocket Fuze T-2025E2

Because of the small number of rounds fired, the results of this test should not be considered as significant until further performance data can be compiled. Steel head-to-motor adapters, rather than aluminum, should be used in future tests of this type versus 1/4" and heavier metal targets to prevent adapter and motor breakup.

4. In view of the limited data appearing to be available, it is recommended that a test program be set up to determine the maximum penetration ability of the 2.75 rocket head Mk 1 versus steel and aluminum targets at all obliquities.

TABLE OF CONTENTS

	Page
SYNOPSIS,	1
TABLE OF CONTENTS	3
AUTHORITY	4 .
REFERENCES	4
BACKGROUND	4
OBJECT OF TEST	4
PERIOD OF TEST	5
REPRESENTATIVE PRESENT	
DESCRIPTION OF ITEM UNDER TEST	5
DESCRIPTION OF TEST EQUIPMENT	6
PROCEDURE	6
RESULTS AND DISCUSSION	7
CONCLUSIONS	9
RECOMMENDATIONS	9
APPENDIX A - TEST RESULTS	TABLE · I
APPENDIX B - NPG PHOTOGRAPHS	FIGURES 1-17 (Incl)
APPENDIX C - DISTRIBUTION	

INTRODUCTION

1. AUTHORITY:

This test was conducted in accordance with Picatinny Arsenal Test Program Request No. 3578 enclosed with reference (b). Authorization for the test was granted by reference (a).

REFERENCES: 2.

- BUORD rest 1tr S78-1(26) Re2b-DBL:ap of 11 Apr 1952
- DA, ORD O ltr to NAVPROV, ORDTA 0.0. 471.82/1907(c) E. B. ANDREWS/pd/77803 of 22 Dec 1952
- NPG Report No. 1023 of 2 Sep 1952 NPG Report No. 1081 of 28 Jan 1952
- ORDTA Dispatch to NAVPROV 272000Z of Jan 1953

3. BACKGROUND:

The first design of the T-2025 fuze, which incorporated an electric detonator, proved to be unsatisfactory from the standpoint of impact sensitivity and delay time after impact (reference (c)). The fuze was then redesigned, with a stab-type detonator in lieu of the electric detonator. This was designated as the T-2025El fuze. The T-2025El plate firing tests conducted at the Naval Proving Ground indicated erratic functioning on 24ST aluminum alloy targets ranging in thickness from "032 to "500 (reference (d)). Since the Navy Mk 176 fuze for the 2175 FFAR Rocket essentially meets all the requirements of the T-2025El fuze, it was decided to terminate the development of the T-2025El fuze and apply all effort toward the development of the T-2025E2 fuze which contains a self destruction feature. The Magnavox Co. of Fort Wayne, Indiana, are the designers and manufacturers of this fuze.

OBJECT OF TEST:

The object of this test was to determine the sensitivity, delay in detonation on target, and functioning at high obliquities of the T-2025E2 fuze.

CONFIDENTIAL

NPG REPORT NO. 1156

Development Test of P.D. Rocket Fuze T-2025E2

5. PERIOD OF TEST:

a.	Date Project Letter	22	Dec	1952
p.	Date Necessary Material Received	14	Jan	1953
C.	Date Commenced Test	22	Jan	1953
d.	Date Test Completed	8	May	1953

6. REPRESENTATIVE PRESENT:

C. L. Hardwick

Magnavox Company

PART C

DETAILS OF TEST

7. DESCRIPTION OF ITEM UNDER TEST:

The fifteen P.D. T-2025E2 fuzes received for this test from Picatinny Arsenal were modified so that they could be armed prior to firing. This was believed necessary since launcher vibration might interfere with the arming mechanism normally employed. The removal of a small pin from the side of the fuze body permitted the spring loaded rotor to move to the in-line position. This operation was done remotely after the round was in the launcher. A drawing of the launcher armed fuze with a description of operation may be found in Figure 1. Figure 2 shows a cut-away view of the fuze. The fuzes used in this test did not contain the self destruction feature.

8. DESCRIPTION OF TEST EQUIPMENT:

 $(\overline{})$

Equipment used in the fuze functioning test consisted of:
NPG 1050 ft. rocket launcher

- 9 2"75 rocket heads Mk 1, modified for and loaded with black powder spotting charges
- 6 2175 rocket heads Mk 1, HBX-1 loaded
- 15 2175 head to 5" HVAR motor adapters, Dwg. PX-8-539
- 15 5" HVAR motors (Temp. 70°F)
 1032, 1375, and 1500 24ST aluminum alloy targets
- 1 35mm Fastax motion picture camera
 Electronic equipment for measurement of fuze functioning
 delay

9. PROCEDURE:

a. The 2175 rocket heads Mk 1 containing the T-2025E2 fuzes were assembled to 5" HVAR motors by means of special adapters and fired from the NPG 1050 ft. launcher. Various thicknesses of 24ST aluminum alloy targets were placed 265 feet from the muzzle end of the launcher. The first three rounds fired contained 3 ounces of black powder in the head as a spotting charge, designed to test the safety of the fuze on the guided launcher. The remaining rocket heads were to be loaded with 1.4 lbs. of HBX-1 explosive. However, the ninth round prematurely detonated on the launcher causing extensive damage. Therefore, when the test was resumed in April, the remaining six fuzes were tested in smoke-puff loaded heads.

b. After the round was placed on the launcher it was prearmed by withdrawing the safety arming pin by means of a lanyard pulled from an adjacent steel shelter. Fuze functioning times were measured with a unit containing an oscilloscope and photo-electric detector by measuring the time from the contact of the nose of the fuze with the plate to the detonation of the head. The contact of the nose with the plate was sensed by means of a contact screen consisting of a sheet of 0.002 lead foil over the striking area of the target. The foil was insulated from the plate by means of a sheet of paper. Circuit closure triggered the sweep of the cathode ray oscilloscope. The flash of the detonation was then detected by the photo-electric cell and applied to the vertical deflection input of the oscilloscope. The time from the beginning of the trace to the burst signal represented the functioning time of the fuze. Striking velocities were obtained by firing through solenoids and recording the impulses on an oscillograph record. A 35mm Fastax Camera, operating at approximately 3000 frames/second, recorded all impacts to determine fuze action.

10. RESULTS AND DISCUSSION:

a. The results of the T-2025E2 fuze functioning test against 24ST aluminum are summarized below:

HBX-1 Loaded Heads

No. of Rds.	Target Thickness	<u>Obliquity</u>	Fuze Action				
2 3 1	1 500 1 375 1 032	0° 0°	2 HO 1 HO, 2 Duds HO on launcher				

Black Powder Loaded Heads

No. of Rds.	Target Thickness	Obliquity	Fuze Action
4	1 032	0°	3 HO, 1 Dud
	1032	60°	HO
2	¥375	60°	2 HO
2	¥375	0°	1 HO*, 1 Dud

^{*} No film record but visually observed as a HO.

()

- b. On the ninth round there was a premature detonation on the guided launcher after approximately 1000 ft. of rocket travel. Figure 3 shows the damage that resulted. It is believed that launcher vibration caused the firing pin detent to move sufficiently to free the firing pin and fire the fuze. The test was temporarily discontinued at this time.
- c. The HBX-1 loaded heads fired against the \$\cong 375\$ and \$\cong 500\$ targets displayed a yellow-white smoke upon detonation indicating a possible low order. By reference (e) three of the 2\cong 75 rocket heads Mk 1 were statically detonated without fuzes to compare the detonation characteristics with those fired off the launcher. Photographs and fragment velocity measurements of the static detonations indicated that these three rounds fired high order (Figure 8). The statically detonated rounds produced a grayish black smoke differing in appearance from the launcher fired rounds.
- d. Film records of the smoke-puff loaded rounds also gave some evidence that the 2475 rocket head Mk 1 might have deflagrated on impact with 4375 aluminum at 0° and 60° obliquity. Fuze action on round 13 had visually been determined as high order at the time of the test, however, photographs show that the black powder actually had spilled from the head and partially ignited and no fuze action was present (Figure 12). Four inert heads were then given a penetration test with the following results:

Rd. No.	24ST Al Thickness	<u>Obliquity</u>	Velocity (ft/sec)	<u>Penetration</u>	Results
1 2 3 4	1375 1375 1375 1375	60° 60° 60°	1814 1773 Missed 1783	Complete Complete Complete Complete	See below See below See below See below

All heads were assembled to 5" HVAR motors by aluminum adapters and fired from the NPG 1050 ft. launcher. The heads were inert loaded to a point 4" below the forward face of the head. The head used on round 2 had four 5/8" holes drilled through the side wall approximately 3-1/2" from the forward face to permit emission of a smoke-puff. The other three heads were not drilled. A steel nose plug was used in place of the fuze. The condition of the heads after penetration was determined by photographs from a ballistic synchro and 35mm Fastax camera behind the target. Camera results (Figures 14-17) clearly indicate the aluminum head-to-motor adapter

()

Development Test of P.D. Rocket Fuze T-2025E2

has shattered resulting in a break up of the motor tube. No conclusions can be reached from the photographs as to the condition of the head. Additional penetration data should be obtained on the ability of the 2.75 Mk I head to penetrate targets heavier than 1/4" aluminum at high obliquities. Little data appear to exist on the penetration ability of the head at the present time. Table I gives the results of the fuze functioning test by rounds and Figures 4-7 and 9-13 show the action as recorded by a 35mm Fastax Camera.

PART D

CONCLUSIONS

- 11. It is concluded that the T-2025E2 fuze:
- a. Will function on 24ST aluminum alloy targets as light as "032 in thickness.
- b. Functioned on "500 aluminum alloy targets with a delay time of approximately 300 microseconds.
- c. Will function on a light aluminum target ("032) at a 60° obliquity.

Because of the small number of rounds fired, the results of this test should not be considered as significant until further performance data can be compiled. Steel head-to-motor adapters, rather than aluminum, should be used in further tests of this type versus 1/4" and heavier metal targets to prevent adapter and motor break up.

PART E

RECOMMENDATIONS

12. In view of the limited data appearing to be available, it is recommended that a test program be set up to determine the maximum penetration ability of the 2475 rocket head Mk l versus steel and aluminum targets at all obliquities.

CONFIDENTIAL SECURITY INFORMATION

NPG REPORT NO. 1156

Development Test of P.D. Rocket Fuze T-2025E2

The tests upon which this report is based were conducted by: F. W. KASDORF, Rocket Battery Officer
Rocket Battery Division
Terminal Ballistics Department

This report was prepared by:
R. G. SONG, Ensign, USNR, Rocket Battery Firing Officer
Rocket Battery Division
Terminal Ballistics Department

This report was reviewed by:
R. H. LYDDANE, Director of Research
Terminal Ballistics Department
W. B. ROBERTSON, Lieutenant Commander, USN
Terminal Ballistics Officer
Terminal Ballistics Department
C. C. BRAMBLE, Director of Research, Ordnance Group

APPROVED: J. F. BYRNE
Captain, USN
Commander, Naval Proving Ground

E. A. RUCKNER
Captain, USN
Ordnance Officer
By direction

CONFIDENTIAL

NPG REPORT NO. 1156

U. S. NAVAL PROVING GROUND DAHLGREN, VIRGINIA

Fifth Partial Report

on

Army R&D Aircraft' Rocket Fuzes

Final Report

on

Development Test of P.D. Rocket Fuze T-2025E2

Project No.: Chief of Ord. TAl-2704 Copy No.: 5 No. of Pages: 10

Date: AUG 24 1953

TABLE I

IMPACT FUNCTIONING RESULTS OF T-2025E2 FUZE IN 2"75 ROCKET HEAD MK 1

Dates Fired; 22 Jan 1953

•				•												
Fure Delay	*	i	į	300 ± 40	290 ± 40	Missed	1		! !	į			7 8 8	I I	1 6	
Fuze Action	HO	HO	HO	HO	HO.	OH	Duđ	Dud	HO on launcher	HO	Dud (HO on water)	OH	Dud	HO	OH*	
Striking Velocity (ft/sec)	Missed	1743	1714	Missed	Missed	1680	1680	1684	;	Missed	Missed	1783	1780	1762	Missed	
Obliquity	00	°09	00	00	00	00	00	၀	00	0	0 0	6 09	00	9 09	00	
24ST Al Thickness	*032	1 032	¶032	#200	. 200	4375	#375	1375	# 032	103 2	#032	:375	#375	#375	4375	
Head Loading	Black Powder	Black Powder	Black Powder	HBX-1	HBX-1	HBX-1	HBX-1	HBX-1	HEX-1	Black Powder	Black Powder	Black Powder	Black Powder	Black Powder	Black Powder	
Fuze No.	13	14	15	- -1	82	က	4	S)	9	11	ឌ	o,	7	æ	10	
و <u>چ</u>	-	82	ĸ	4	ß	9	7	ဆ	ი	0	ri.	ભ	80	付	ري ريا	

All rounds fired from NPG 1050 ft. launcher with single 5" HVAR motor Mk 10 Mod 6 at ambient temperature (70°F) with aluminum head-to-motor adapters. NOTE:


Due to insufficient light given off by the detonation of the black powder loaded heads, delay time measurements were not taken on these rounds.

* No film record but visually observed as HO.

CONFIDENTIAL SECURITY INFORMATION

APPENDIX A



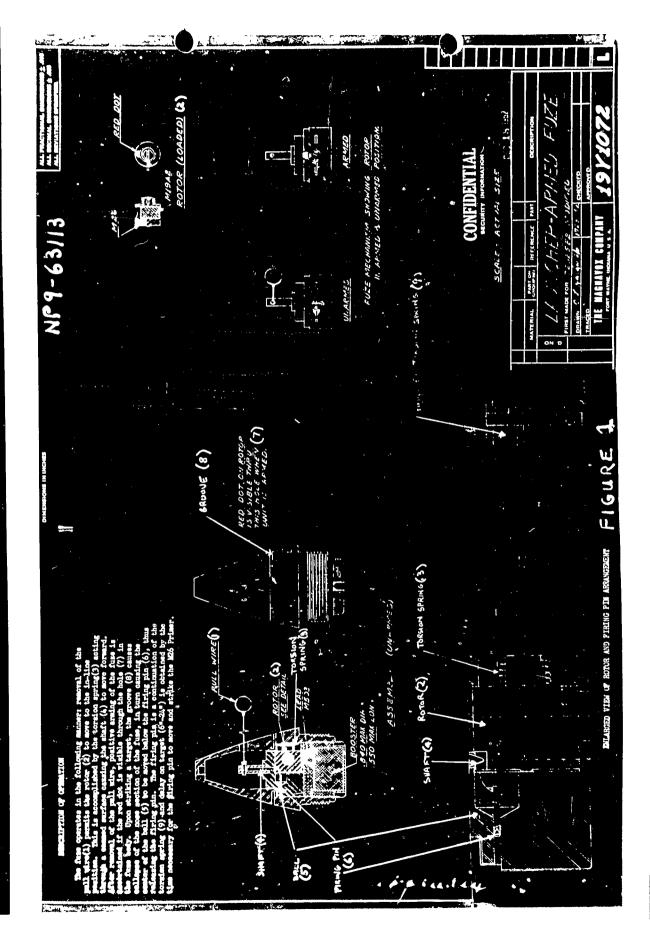


.D. fuze for 2"75 rocket. lew of partially sectioned I-3

U.S.N.P.G. DAHLGREN, VIRGINIA


3 INCHES


Appendix B


S

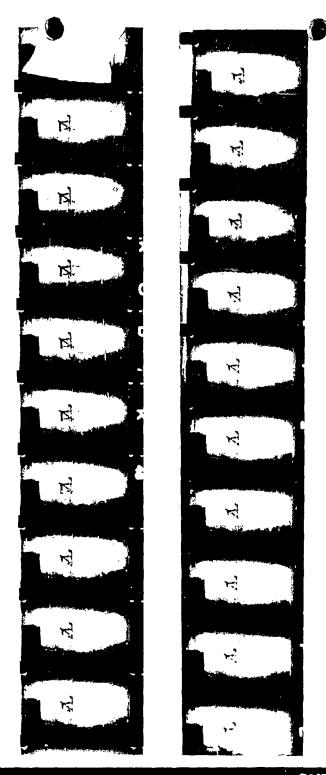

NP9-63115 22 January 1953 SECURITY INFORMATION Functioning Test of T2025E2 P.D. fuze for 2".75 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 3 - Impact of rocket on "032 aluminum, 24ST alloy at 0° obliquity. Striking Velocity: 1714 ft/sec. Fuze Action: HO (Black powder loaded head). Figure 4

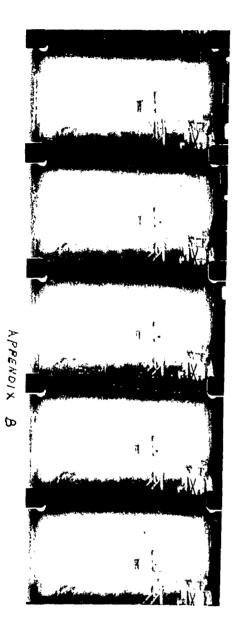

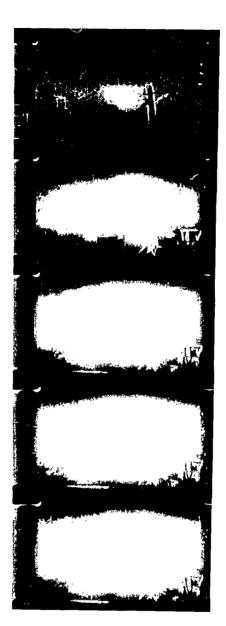

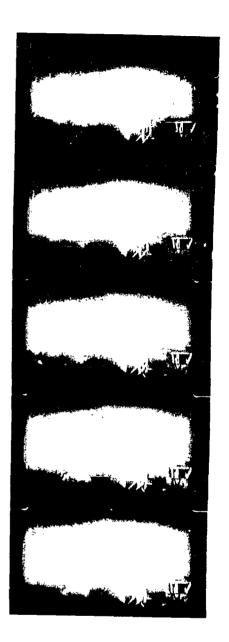



MP9-63116


22 January 1953

Functioning Test of T2025E2 P.D. fuze for 2".75 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 4 - Impact of rocket on "500 aluminum, 24ST alloy at 0° obliquity. Striking Velocity: Approximately 1700 ft/sec. Fuze Action: H0 (HBX-1 loaded). Fuzé Delay: 300±40 microseconds.

Figure 5

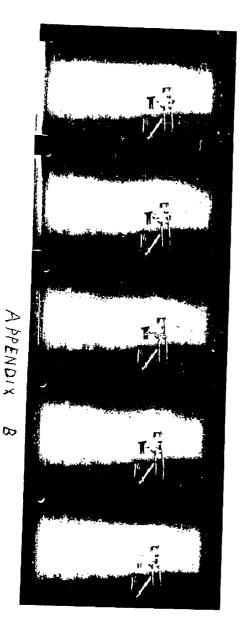

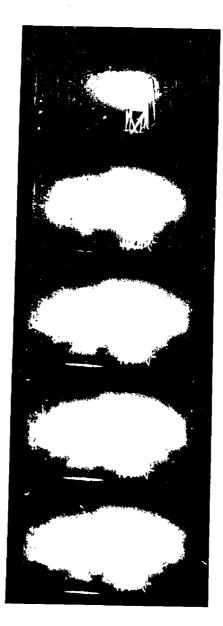

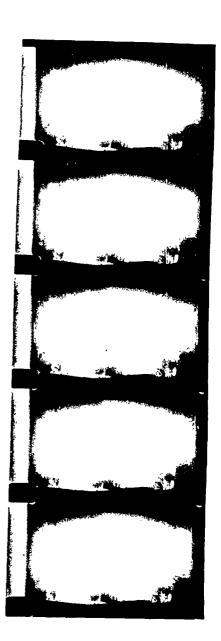


NP9-63117

22 January 1953

Functioning Test of T2025E2 P.D. fuze for 2"75 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 5 - Impact of rocket on "500 aluminum, 24ST alloy at 0° obliquity. Striking Velocity: Approximately 1700 ft/sec. Fuze Action: H0 (HBX-1 loaded). Fuze Delay: 290±40 microseconds.

Figure 6

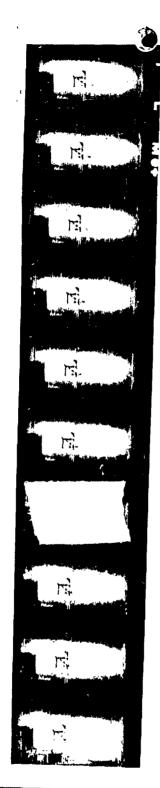








NP9-63118

22 January 1953


Functioning Test of T2025E2 P.D. fuze for 2"75 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 6 - Impact of rocket on "375 aluminum, 24ST alloy at 0° obliquity. Striking Velocity: 1680 ft/sec. Fuze Action: HO (HBX-I loaded). Figure 7

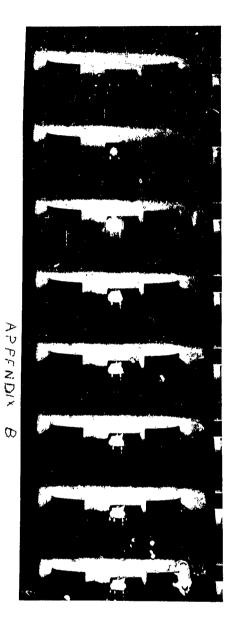


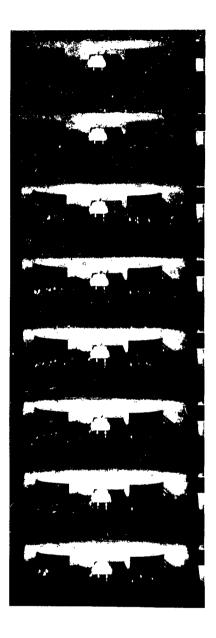

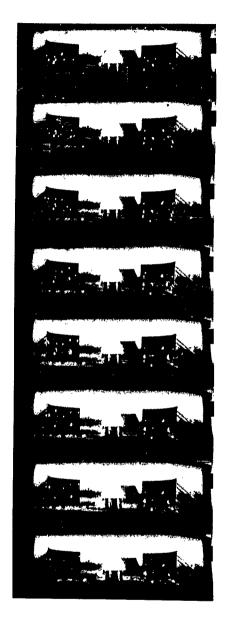

NP9-63119 5 February 1953 SECURITY INFORMATION View of static detonation of 2.75 rocket head Mk 1, HBX-1 loaded. The head did not contain a fuze. Explosive Action: High order. Figure 8

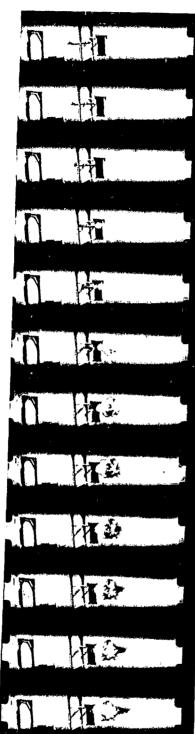


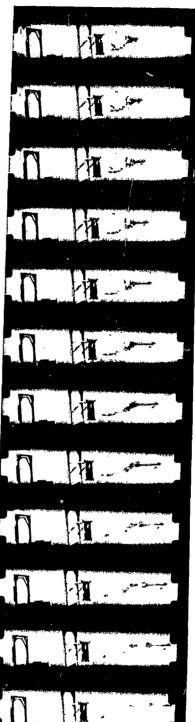


NP9-63515

28 April 1953

Functioning Test of T2025E2 P.D. Fuze for 2775 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 10 - Impact of rocket on 7032 aluminum, 24ST alloy at 0° obliquity. Striking Velocity approximately 1700 ft/sec. Fuse Action: HO (Black powder loaded head).

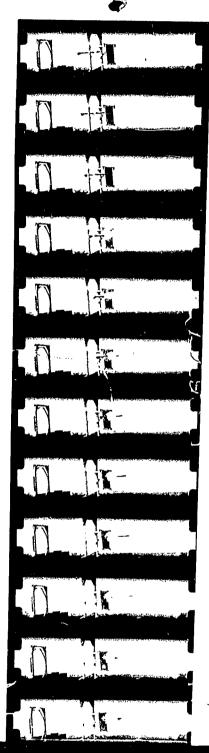

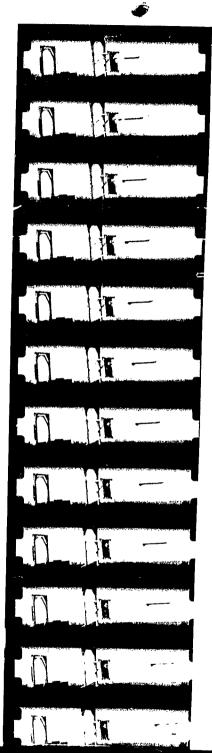


NP9-63516


28 April 1953

Functioning Test of T2025E2 P.D. Fuze for 2075 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 11 - Impact of rocket on 2032 aluminum, 24ST alloy at 0° obliquity. Striking Velocity approximately 1700 ft/sec. Fuse Action: DUD.

Figure 10 NP9-63516

CONFIDENTIAL

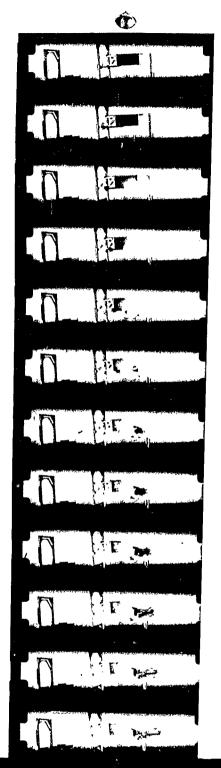


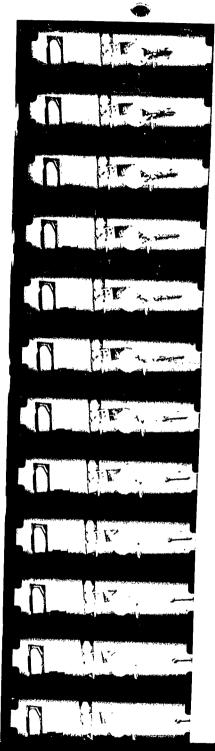


NP9-63517

28 April 1953


SECURITY INFORMATION
Functioning Test of T2025E2 P.D. Fuze for 2775 rocket. Fired from
NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 12 - Impact
of rocket on 7375 aluminum, 24ST alloy at 60° obliquity. Striking
Velocity 1783 ft/sec. Fuze Action: HO (Black powder loaded head).
Figure 11

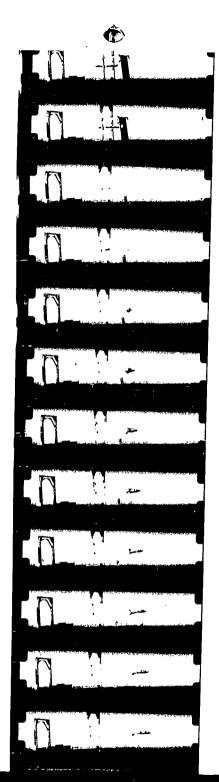


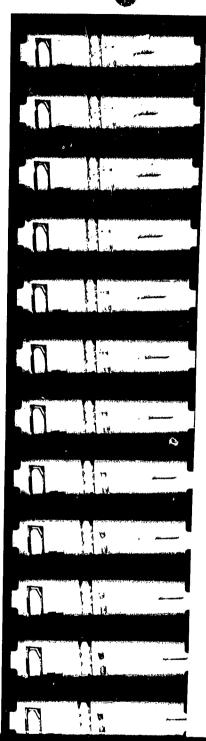


NP9-63518 . 28 April 1953 SECURITY INFORMATION Functioning Test of T2025E2 P.D. Fuze for 2.75 rocket. Fired from NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 13 - Impact of rocket on .375 aluminum, 24ST alloy at 0° obliquity. Striking Velocity 1780 ft/sec. Fuze Action: DUD.

Figure 12

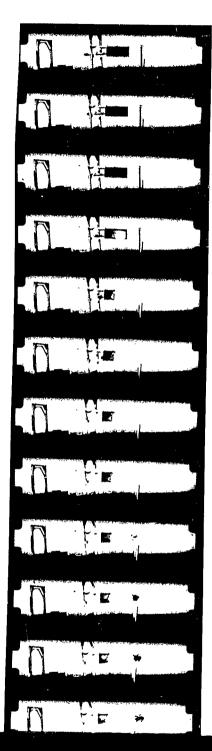

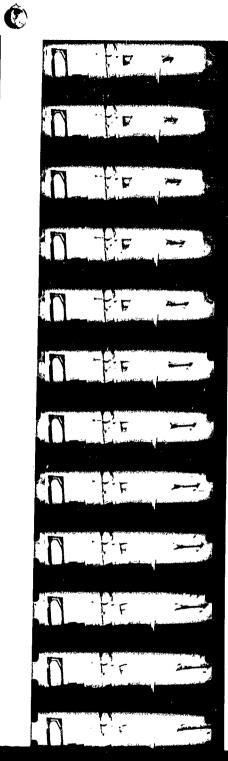

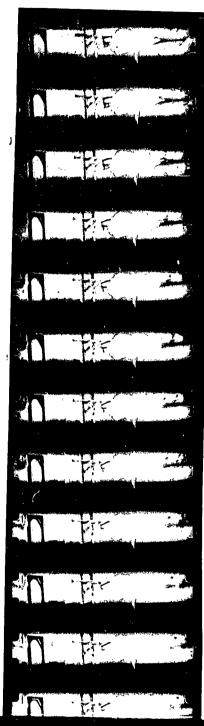

(

CONFIDENTIAL
NP9-63519

28 April 1953


SECURITY INFORMATION
Functioning Test of T2025E2 P.D. Fuze for 2.75 rocket. Fired from
NPG 1050 ft. launcher with 5" HVAR motor. View: Rd. 14 - Impact
of rocket on 1375 aluminum, 24ST alloy at 60° obliquity. Striking
Velocity 1762 ft/sec. Fuze Action: HO (Black powder loaded head).
Figure 13

The condition of the head cannot be determined luminum, 245T alloy notor, Striking Ve ninum heac-to-notor acarter has shattered CCAFIDENTIAL SECURITY INFO NVAR notor, Stri







Note the extensive aluminum, 248T alloy IVAR motor. Striking The aluminum SECURITY INFORMATION The head-to-motor adapter has shattered resulting in a break up of the motor. condition of the head cannot be determined from these pictures. Note the plate flash. 1050 ft. launcher with 5" HVAR motor. 35mm Fastax camera film of Rd. 2. The CONFIDENT rocket 5 May 2 75 MK View shows Fired from NPG Penetration Test of inert at 50° obliquity. Fired 1 Velocity 1773 ft/sec. Vie /sec• NP9-63521

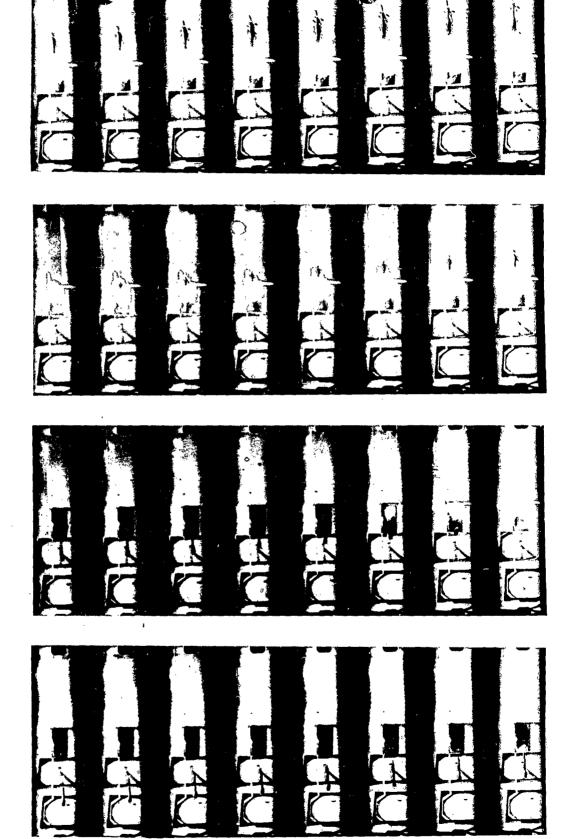


motor. The condition of the head cannot be determined from these pictures. The aluminum head-to-motor Velocity approximately Penetration Test of at 60° obliquity. F

Figure 16 the extensive plate flash.

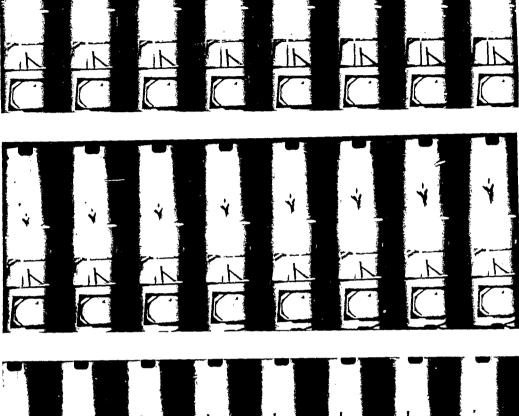

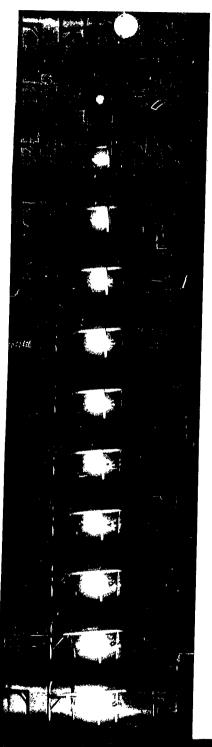

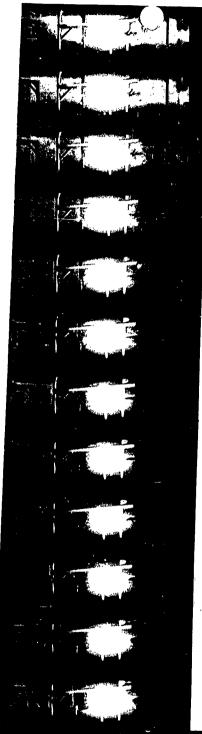

NP9-63523

8 May 1953

Penetration Test of inert 2975 Mk 1 rocket head against 375 aluminum, 24ST alloy at 60° obliquity. Fired from NPG 1050 ft. launcher with 5 HVAR motor. Striking Velocity 1783 ft/sec. View shows 35mm Fastax camera film of Rd. 4. The head-to-motor aluminum adapter has shattered resulting in a break up of the motor. The condition of the head cannot be determined from these pictures. Note the extensive plate flash.

Figure 17